



PRIMER/MEMBRANE

VAPOR RETARDING PENETRANTS

Weighted T-Bar Application Method

Step 1:

Tape off all entrances with caution tape and ventilate, turn on HVAC.

Step 2:

Be sure to shake or pull any loose fibers from weighted T-bar applicator.

Step 3:

Fill a 1gal plastic watering can with Hydro-Seal Primer/Membrane. It is a good idea to fill near your starting point so any spills can be feathered into the floor.

Note: Refer to Hydro-Seal TDS and MSDS for other directions and safety information.

Step 4:

Pour a small puddle, 12 inch diameter of Primer/Membrane on the floor to saturate the pad and drag material out until pad dries then repeat.

Step 5:

Try to pour a 2" wide strip down the length of the area. Only apply in sections of 500sf at a time. This allows control of the area and reduces contamination from the work environment. Continue back and forth feathering the coating out, pouring additional beads as needed. Only pour fresh material on dry areas to avoid excessive application.

Step 6:

Be sure to angle the applicator (about 10 degrees) so finish runs off to the unfinished side of the floor. Move the liquid material like you would squeegee water. Do not allow a puddle of finish to form in front of the applicator.

Step 7a or 7b:

Move at a slow walk and be sure to apply less coating as you approach the wall,

For Membrane: matte heavy glossy areas before they set-up and do not attempt to create surface film. Topical film material is useless and may require removal.

Step 8:

Use caution on turns to eliminate puddles and missed areas.

Step 9:

When the 1gal watering is empty, stop and allow this section to dry suitable for boot traffic before proceeding.

Step 10: MEMBRANE ONLY

After the first coat is applied the appearance will be like damp concrete. Relax it won't look like enough but it is! Wrap applicator in a plastic garbage bag while waiting. Repeat procedure for second coat. Only apply what the substrate will allow to avoid surface film build up. **Call Tech Service immediately if you have questions.**

Step 11:

When the final coat of Hydro-Seal Primer/Membrane is completely applied, pour coating from watering can back into original container.

Step 12:

Wrap applicator head in a plastic bag and discard when finished.

